


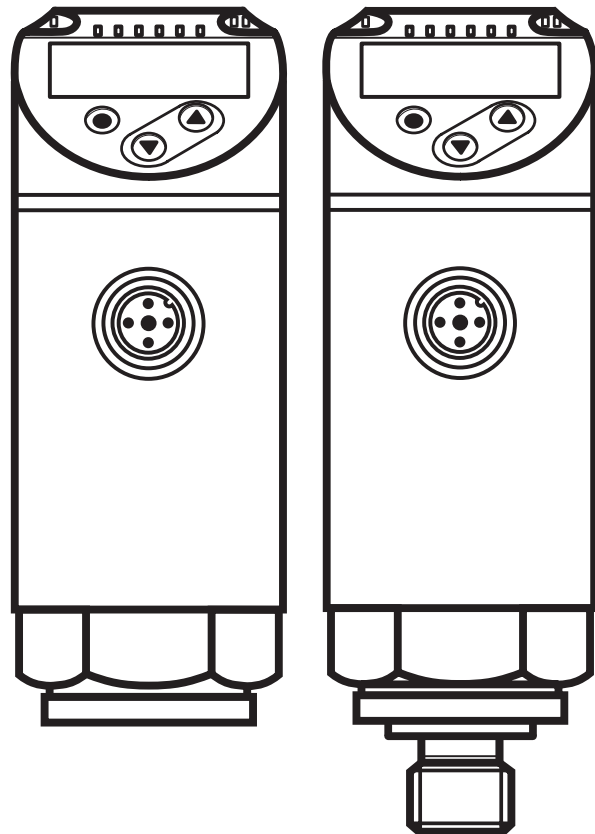

Operating instructions
Electronic pressure sensor
PN7xxx

UK

80290849 / 00 12 / 2019



Contents



1	Preliminary note.....	3
1.1	Symbols used	3
2	Safety instructions	4
3	Functions and features	4
3.1	Applications	5
4	Function.....	6
4.1	Operating modes	7
4.2	Communication, parameter setting, evaluation	8
4.3	Switching function.....	9
4.4	IO-Link.....	10
4.4.1	General information.....	10
4.4.2	Functions only available via IO-Link communication.....	10
5	Installation.....	11
6	Electrical connection.....	12
7	Operating and display elements	13
8	Menu.....	14
8.1	Menu structure: main menu.....	14
8.2	Explanation of the menu	15
8.2.1	Explanation of menu level 1	15
8.2.2	Explanation of menu level 2	15
9	Parameter setting	16
9.1	Parameter setting in general	16
9.2	Define the operating mode (optional)	19
9.3	Configure display (optional).....	19
9.4	Set output signals	20
9.4.1	Set output functions.....	20
9.4.2	Set switching limits for the hysteresis function	20
9.4.3	Set switching limits for the window function	20
9.5	User settings (optional).....	21
9.5.1	Set delay time for the switching outputs	21
9.5.2	Set output logic for the switching outputs	22
9.5.3	Set damping for the switching signal	22

9.5.4	Reset all parameters to factory setting	22
9.5.5	Set colour change of the display	23
9.5.6	Graphical depiction of the colour change of the display	24
9.6	Diagnostic functions	27
9.6.1	Read min/max values for the system pressure	27
9.6.2	Read overload processes	27
10	Operation	27
10.1	Read the set parameters	27
10.2	Self-diagnostics / fault indications	28
11	Technical data	29
11.1	Setting ranges	29
11.1.1	Setting ranges in operating mode 2	29
11.1.2	Setting ranges in operating mode 3	30
11.2	Further technical data	32
12	Factory setting	33

UK

1 Preliminary note

1.1 Symbols used

- ▶ Instruction
- > Reaction, result
- [...] Designation of keys, buttons or indications
- Cross-reference
-  Important note
Non-compliance may result in malfunction or interference
-  Information
Supplementary note

2 Safety instructions

- The device described is a subcomponent for integration into a system.
 - The manufacturer is responsible for the safety of the system.
 - The system manufacturer undertakes to perform a risk assessment and to create documentation in accordance with legal and normative requirements to be provided to the operator and user of the system. This documentation must contain all necessary information and safety instructions for the operator, the user and, if applicable, for any service personnel authorised by the manufacturer of the system.
- Read this document before setting up the product and keep it during the entire service life.
- The product must be suitable for the corresponding applications and environmental conditions without any restrictions.
- Only use the product for its intended purpose (→ Functions and features).
- Only use the product for permissible media (→ Technical data).
- If the operating instructions or the technical data are not adhered to, personal injury and/or damage to property may occur.
- The manufacturer assumes no liability or warranty for any consequences caused by tampering with the product or incorrect use by the operator.
- Installation, electrical connection, set-up, programming, configuration, operation and maintenance of the product must be carried out by personnel qualified and authorised for the respective activity.
- Protect units and cables against damage.

3 Functions and features

The device monitors the system pressure of machines and installations.

3.1 Applications

Type of pressure: relative pressure

Order no.	Measuring range		Permissible overload pressure *)		Bursting pressure	
	bar	PSI	bar	PSI	bar	PSI
Pressure sensors with G $\frac{1}{4}$ internal thread						
PN7160	0...600	0...8700	800	11580	2500	36250
PN7070	0...400	0...5800	800	11580	1700	24650
PN7071	0...250	0...3620	500	7250	1200	17400
PN7012	0...160	0...2321	350	5100	750	10900
PN7092**	0...100	0...1450	300	4350	650	9400
PN7043	0...40	0...580	200	3000	500	7200
PN7093**	0...25	0...362	150	2175	350	5075
PN7014	-1...16	-14,5...232,1	85	1250	150	2200
PN7094**	-1...10	-14,5...145	75	1087	150	2175
PN7015	-1...6	-14,5...87	40	600	100	1500
PN7096	0...2,5	0...36,2	20	290	50	725
PN7097	0...1	0...14,5	10	145	30	450
PN7099	-1...1	-14,5...14,5	10	145	30	450
Pressure sensors with G $\frac{1}{4}$ external thread						
PN7560	0...600	0...8700	800	11580	2500	36250
PN7570	0...400	0...5800	800	11580	1700	24650
PN7571	0...250	0...3620	500	7250	1200	17400
PN7512	0...160	0...2321	350	5100	750	10900
PN7592**	0...100	0...1450	300	4350	650	9400
PN7543	0...40	0...580	200	3000	500	7200
PN7593**	0...25	0...362	150	2175	350	5075
PN7514	-1...16	-14,5...232,1	85	1250	150	2200
PN7594**	-1...10	-14,5...145	75	1087	150	2175
PN7515	-1...6	-14,5...87	40	600	100	1500
PN7596	0...2,5	0...36,2	20	290	50	725
PN7597	0...1	0...14,5	10	145	30	450
PN7599	-1...1	-14,5...14,5	10	145	30	450

UK

- *) With static overload pressure or max. 100 million pressure cycles.
- ***) Use devices with a measuring range ≥ 250 bar for gas applications > 25 bar!
As an alternative, ifm's PN7072 or PN7572 sensors can be used for gas applications for a measuring range of 0...100 bar.

MPa = (measured value in bar) \div 10

kPa = (measured value in bar) \times 100



Avoid static and dynamic overpressure exceeding the specified overload pressure by taking appropriate measures. The indicated bursting pressure must not be exceeded.

Even if the bursting pressure is exceeded only for a short time, the unit may be destroyed. NOTE: Risk of injury!



The units are vacuum resistant.



Pressure Equipment Directive (PED):

The units comply with the Pressure Equipment Directive and are designed and manufactured for group 2 fluids in accordance with the sound engineering practice. Use of group 1 fluids on request!

4 Function

- The unit displays the current system pressure.
- It generates output signals according to the operating mode and the parameter setting.
- It moreover provides the process data via IO-Link.
- The unit is designed for fully bidirectional communication.

So the following options are possible:

- Remote display: reading and displaying the current system pressure.
- Remote parameter setting: reading and changing the current parameter setting.
- IO-Link parameter setting (\rightarrow 4.4)

4.1 Operating modes




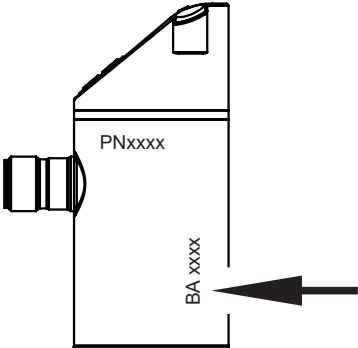
The following units are only supplied with operating mode [3]: PN2x12, PN2x43, PN2x14, PN2x15. These units do not feature any other operating mode and therefore menu item [CMPT] (→ 9.2) is not available.


Operating mode 1	
If operating mode 1 is used, note the operation instructions of the old devices, as the device functions may differ from these operating instructions. Operating instructions: → www.ifm.com	
Description	In this operating mode the sensor behaves like its previous version. The following old devices are concerned: PE7002, PE7003, PE7004, PE7006, PE7009. PN7000, PN7001, PN7002, PN7003, PN7004, PN7006, PN7007, PN7009, PN7060, PN7200, PN7201, PN7202, PN7203, PN7204, PN7206, PN7207, PN7209, PN7300, PN7302, PN7303, PN7304. PY7000, PY7001, PY7002, PY7003, PY7100.
Application	To ensure compatibility to old devices if sensors are replaced.
IODD designation	IO Device Description - IODD: At www.ifm.com in the download area of the corresponding old device.

UK

Operating mode 2	
Description	Operating mode on delivery. For exceptions, see note at the beginning of this chapter.
Application	Standard applications.
IODD designation	E.g. PN7094 Factory setting / (CMPT = 2): At www.ifm.com in the download area of the corresponding article.

Operating mode 3

Description	<p>High IO-Link process value and parameter resolution (device-specific: see IODD suitable for the operating mode). The menu items [ou1] and [ou2] are extended by the setting option [OFF] (→ 9.4.1). IO-Link standard command "Flash on" is available (→ 4.4.2). The following IO-Link markings are available: Application Specific Tag, Function Tag and Location Tag (→ 4.4.2).</p> <p> This operating mode is available as of device status BA. For the device status see the labelling on the device.</p> 
Application	<p>Improved controllability via IO-Link. Highly granular setting of switch-on and switch-off points.</p>
IODD designation	<p>E.g. PN7094 Status_B High Resolution / (CMPT = 3): E.g. PN7012 Status_B At www.ifm.com in the download area of the corresponding article.</p>

 Manual selection of the operating mode see (→ 9.2), selection of the operating mode via IO-Link interface see → additional document on the selection of the operating mode at www.ifm.com

4.2 Communication, parameter setting, evaluation

OUT1 (pin 4)	<ul style="list-style-type: none"> • Switching signal for system pressure limit • Communication via IO-Link
OUT2 (pin 2)	<ul style="list-style-type: none"> • Switching signal for system pressure limit

4.3 Switching function

OUTx changes its switching status if it is above or below the set switching limits (SPx, rPx). The following switching functions can be selected:



- Hysteresis function / normally open: [OUx] = [Hno] (→ fig. 1).
- Hysteresis function / normally closed: [OUx] = [Hnc] (→ fig. 1).

First the set point (SPx) is set, then the reset point (rPx).
The hysteresis defined remains even if SPx is changed again.

- Window function / normally open: [OUx] = [Fno] (→ fig. 2).
- Window function / normally closed: [OUx] = [Fnc] (→ fig. 2).

The width of the window can be set by means of the difference between FHx and FLx. FHx = upper value, FLx = lower value.

UK

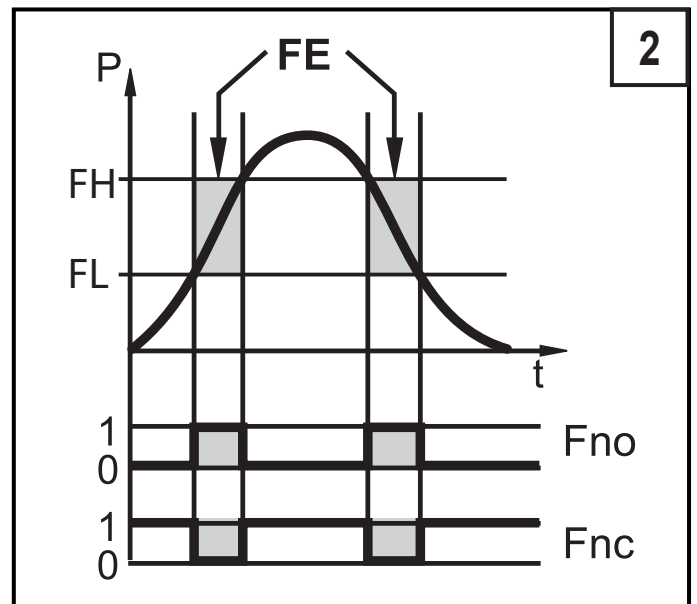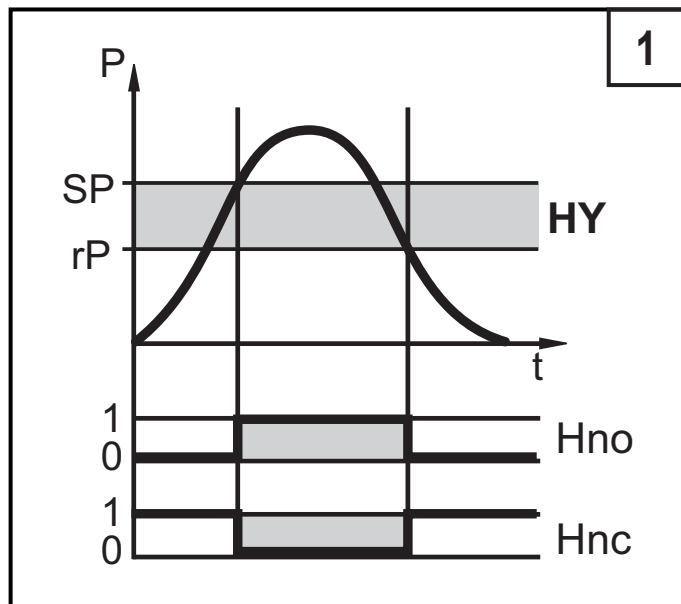

P = system pressure; HY = hysteresis; FE = window



When set to the window function the set and reset points have a fixed hysteresis of 0.25 % of the measuring span.

4.4 IO-Link

4.4.1 General information

This device has an IO-Link communication interface which requires an IO-Link capable module (IO-Link master) for operation.

The IO-Link interface enables direct access to the process and diagnostic data and provides the possibility to set the parameters of the unit during operation.

In addition communication is possible via a point-to-point connection with a USB adapter cable.

The IO-DDs necessary for the configuration of the unit, detailed information about process data structure, diagnostic information, parameter addresses and the necessary information about the required IO-Link hardware and software can be found at www.ifm.com.

4.4.2 Functions only available via IO-Link communication

- HIPC: number of overload processes (→ 9.6.2).
- HIPS: threshold for the overload counter (→ 9.6.2).
- Flash on: via this standard command, the sensor can be localised in the plant. When the command is used, the switching status LEDs flash and "IO-L" is displayed. (Function only available in operating mode [3]).
- Application Specific Tag: freely definable text assigned to the unit.
- Function Tag: freely definable text describing the device function in the plant. (Function only available in operating mode [3]).
- Location Tag: freely definable text describing the installation location in the plant. (Function only available in operating mode [3]).

For more detailed information refer to the device-specific IO Device Description PDF at www.ifm.com.

5 Installation



Before installing and removing the unit: Make sure that no pressure is applied to the system.

- ▶ Insert the unit in a G $\frac{1}{4}$ process connection.
- ▶ Tighten firmly. Recommended tightening torque:

Pressure range in bar	Tightening torque in Nm
-1...400	25...35
600	30...50
Depends on lubrication, seal and pressure load.	

UK

The sensor housing can be rotated by 345° with regard to the process connection.



Do not rotate past the end stop!

6 Electrical connection




The device must be connected by a qualified electrician.

The national and international regulations for the installation of electrical equipment must be adhered to.


Voltage supply according to EN 50178, SELV, PELV.

► Disconnect power.

► Connect the device as follows:

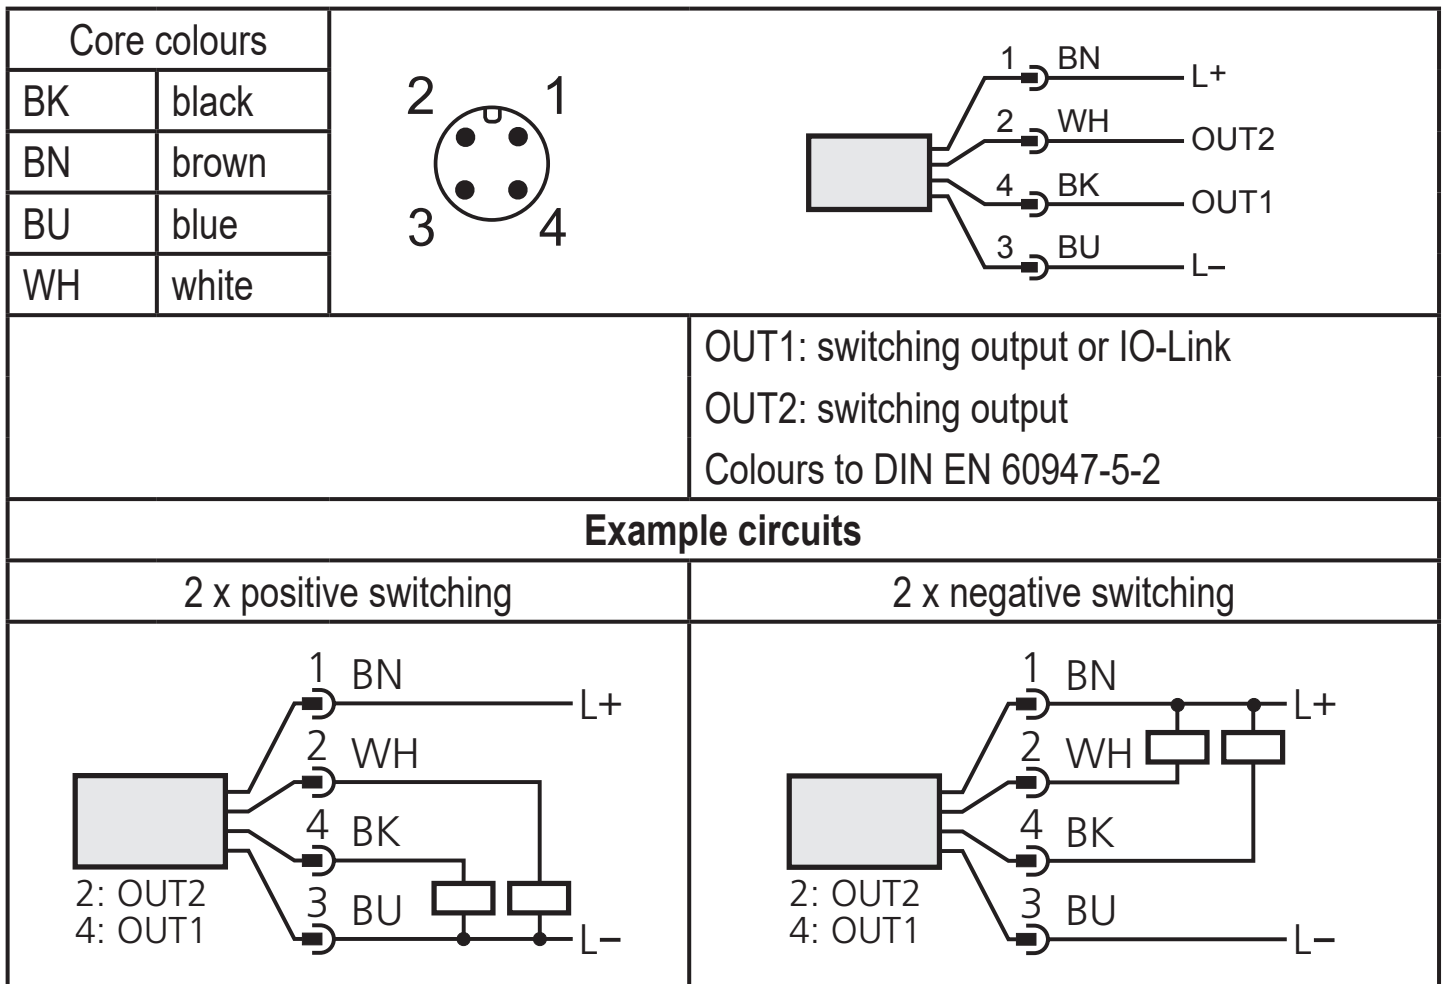

7 Operating and display elements

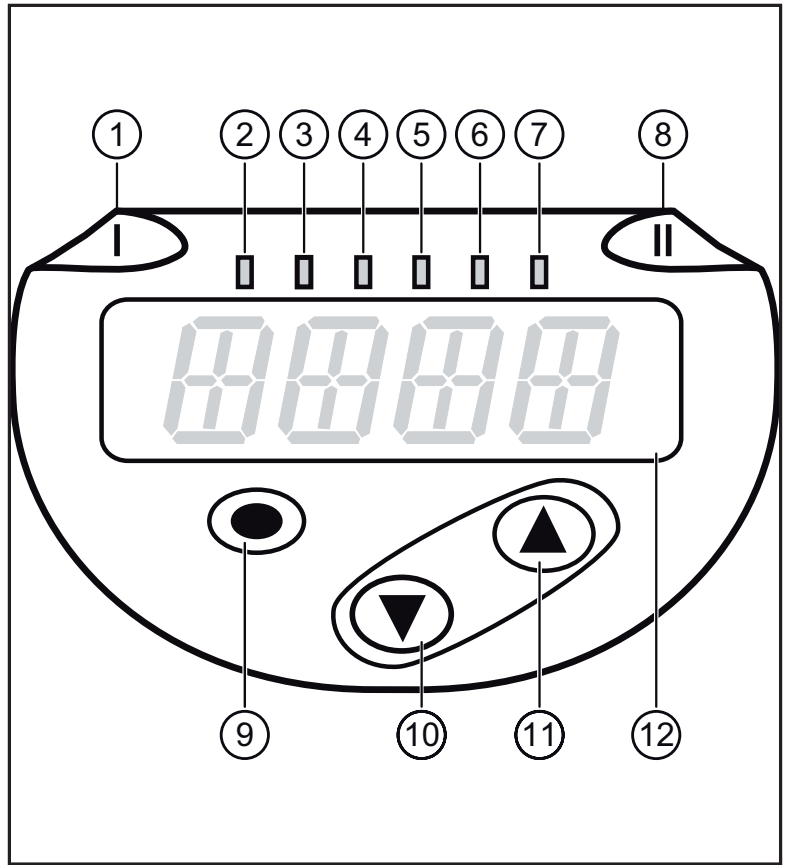


UK

1 to 8: Indicator LEDs	
LED 1	Switching status OUT1 (on if output 1 is switched).
LED 8	Switching status OUT2 (on if output 2 is switched).
LEDs 2 - 7	System pressure in the indicated unit of measurement.
9: Enter button [•]	
- Selection of the parameters and acknowledgement of the parameter values.	
10 to 11: Arrow keys up [▲] and down [▼]	
- Setting of the parameter values (scrolling by holding pressed, incrementally by pressing once).	
12: Alphanumeric display, 4 digits	
- Display of the current system pressure.	
- Display of the parameters and parameter values.	

8 Menu

8.1 Menu structure: main menu

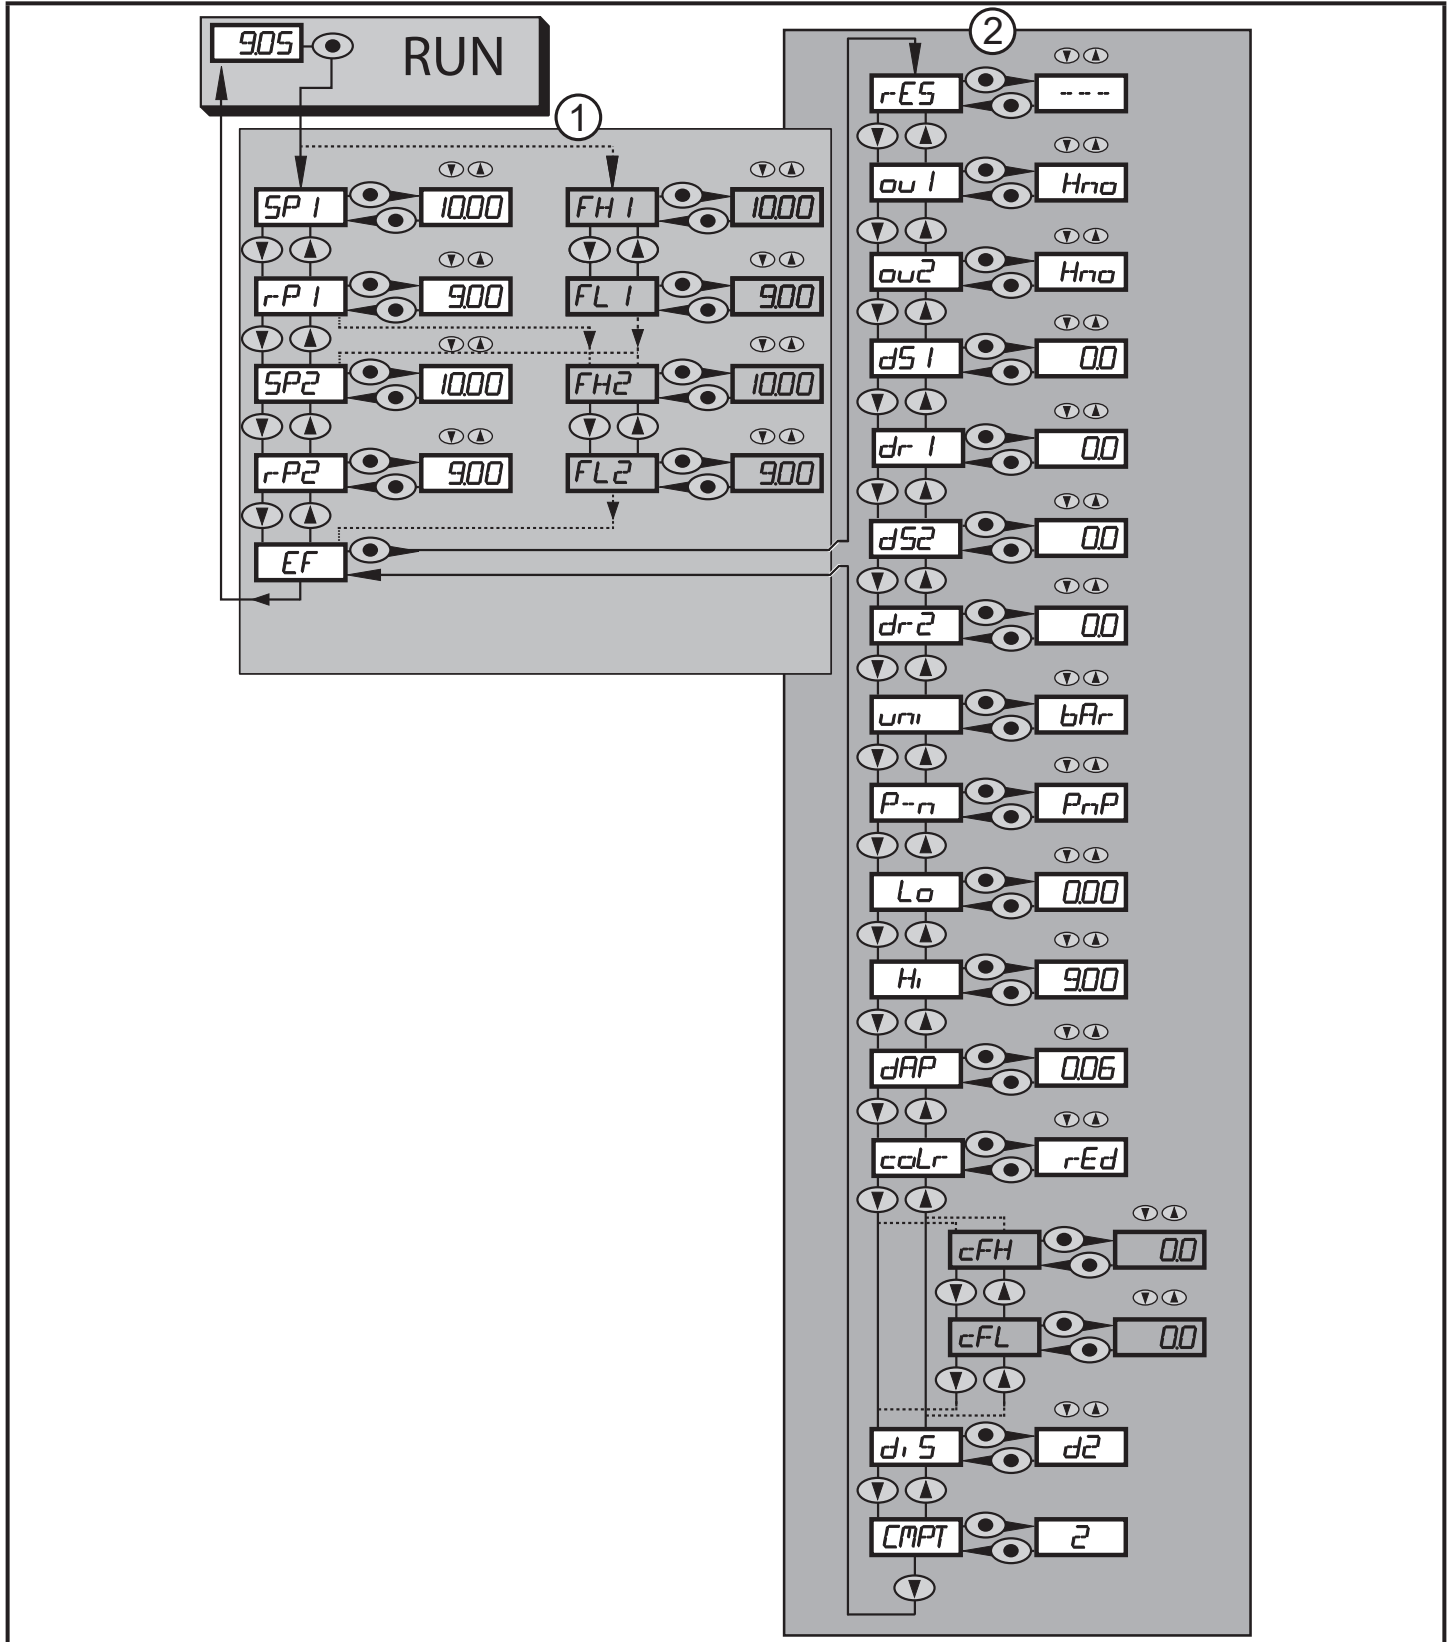

Menu items highlighted in grey, e.g. [FH1] are only active when assigned parameters have been selected.



Menu item [CMPT] is not available for all articles (→ 4.1).


8.2 Explanation of the menu


8.2.1 Explanation of menu level 1

SPx/rPx	Upper / lower limit for system pressure at which OUTx switches with hysteresis setting. SPx/rPx is displayed if the parameter [Hno] or [Hnc] was set for OUTx in the menu Extended Functions "EF".
FHx/FLx	Upper / lower limit for system pressure at which OUTx switches with window setting. FHx/FLx is displayed if the parameter [Fno] or [Fnc] was set for OUTx in the menu Extended Functions "EF".
EF	Extended functions / opening of menu level 2.

UK

8.2.2 Explanation of menu level 2

rES	Restore factory setting.
ou1	Output function for OUT1: <ul style="list-style-type: none"> • Switching signal for the pressure limits: hysteresis function [H ..] or window function [F ..], either normally open [. no] or normally closed [. nc]. • Output off [OFF] (function only available in operating mode [3]).
ou2	Output function for OUT2: <ul style="list-style-type: none"> • Switching signal for the pressure limits: hysteresis function [H . .] or window function [F . .] as normally open [. no] or normally closed [. nc] each. • Output off [OFF] (function only available in operating mode [3]).
dS1 / dS2	Switching delay for OUT1 / OUT2.
dr1 / dr2	Switch-off delay for OUT1 / OUT2.
uni	Standard unit of measurement for system pressure (display): [bAr] / [mbar] / [MPa] / [kPa] / [PSI] / [inHG].  The selectable units of measurement depend on the respective unit. See table Setting ranges (→ 11.1.1).
P-n	Output logic: PnP / nPn.
Lo	Minimum value memory for system pressure.
Hi	Maximum value memory for system pressure.
dAP	Damping of the measured signal.
coLr	Assignment of the display colours "red" and "green" within the measuring range.
cFH / cFL	Upper / lower value for colour change. Parameter only active after selection of a freely definable colour window in the coLr parameter: [r-cF] or [G-cF].
diS	Update rate and orientation of the display.





CMPT	Selection of the operating mode  Menu item [CMPT] is not available for all articles (→ 4.1).
------	--

9 Parameter setting

During parameter setting the unit remains in the operating mode. It continues its monitoring functions with the existing parameters until the parameter setting has been completed.

9.1 Parameter setting in general

3 steps must be taken for each parameter setting:

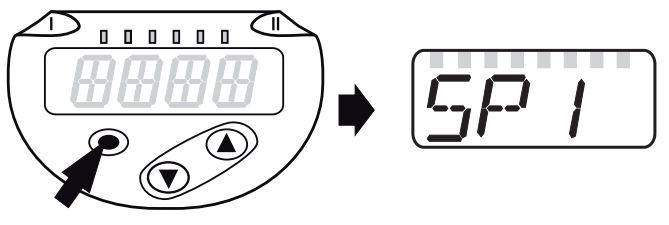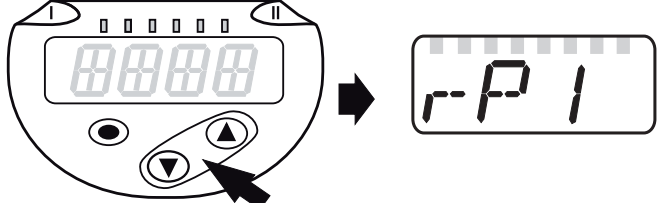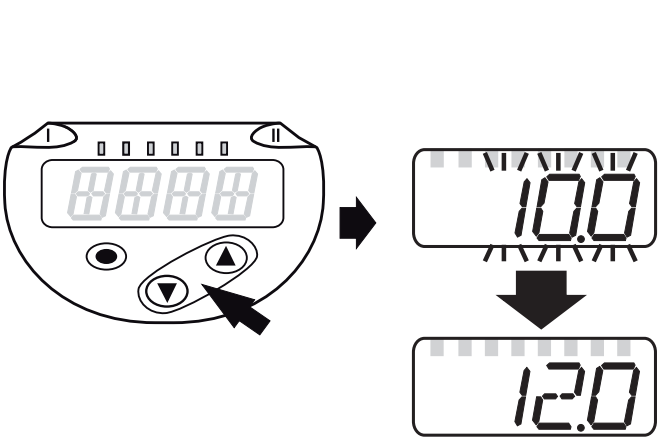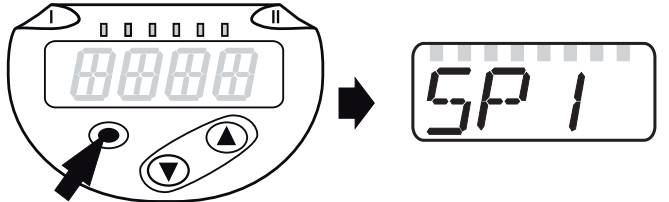1	Select parameter <ul style="list-style-type: none"> ▶ Press [●] to get to the menu. ▶ Press [▲] or [▼] until the required parameter is displayed. 	 
2	Set parameter value <ul style="list-style-type: none"> ▶ Press [●] to edit the selected parameter. ▶ Press [▲] or [▼] for at least 1 s. > After 1 s: setting value is changed: incrementally by pressing the button once or continuously by keeping the button pressed. 	
Numerical values are incremented continuously with [▲] or decremented with [▼].		
3	Acknowledge parameter value <ul style="list-style-type: none"> ▶ Briefly press [●]. > The parameter is displayed again. The new setting value is saved. 	
Set other parameters <ul style="list-style-type: none"> ▶ Press [▲] or [▼] until the required parameter is displayed. 		

Finish parameter setting

- ▶ Press [▲] or [▼] several times until the current measured value is displayed or wait for 30 s.
- > The unit returns to the process value display.



If [C.Loc] is displayed when an attempt is made to modify a parameter value, an IO-Link communication is active (temporary locking).



If [S.Loc] is displayed, the sensor is permanently locked via software. This locking can only be removed with a parameter setting software.

UK

- Change from menu level 1 to menu level 2:

<ul style="list-style-type: none">▶ Press [●] to get to the menu.▶ Press [▲] or [▼] until [EF] is displayed.	
<ul style="list-style-type: none">▶ Press [●].> The first parameter of the submenu is displayed (here: [rES]).	



Change from menu level 1 to menu level 2 when a parameter setting software is used:

Activate the [EF] button.

- Locking / unlocking


The unit can be locked electronically to prevent unintentional settings.

<ul style="list-style-type: none">▶ Make sure that the unit is in the normal operating mode.▶ Press [▲] + [▼] simultaneously for 10 s.> [Loc] is displayed.	
--	--

During operation: [Loc] is briefly displayed if you try to change parameter values.

For unlocking:

- ▶ Press [▲] + [▼] simultaneously for 10 s.
- > [uLoc] is displayed.

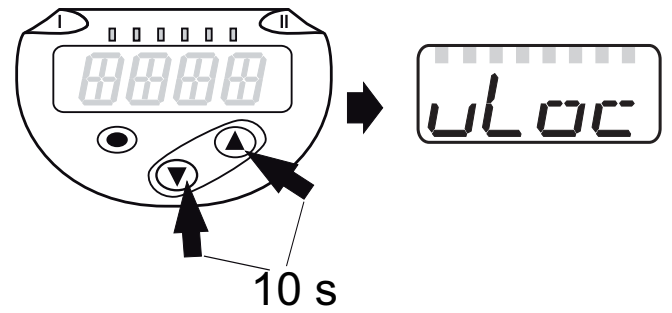

On delivery: not locked.


- Timeout:

If no button is pressed for 30 s during parameter setting, the unit returns to the operating mode with unchanged values.

- Exit a parameter without applying the settings

To exit a parameter without applying the settings:


- ▶ Press [▲] + [▼] simultaneously.
- > Return to the menu level.

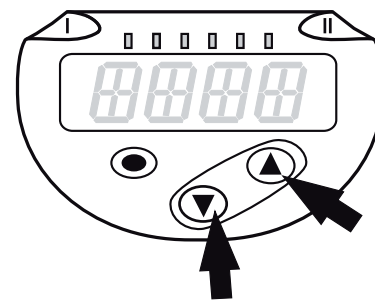


- Exit menu level



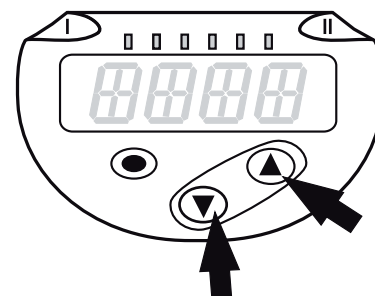

To exit the menu level:

- ▶ Press [▲] + [▼] simultaneously.
- > Menu level 2 changes to level 1
or
level 1 changes to display.







9.2 Define the operating mode (optional)

 Menu item [CMPT] is not available for all articles (→ 4.1).

<p>▶ Select [CMPT] and set the operating mode</p> <ul style="list-style-type: none"> - [1] = operating mode 1 - [2] = operating mode 2 - [3] = operating mode 3 	
<p> Description of the operating modes see (→ 4.1)</p>	
<p> When using IO-Link, an IODD suitable for the operating mode must be used.</p>	
<p> When the operating mode is changed, all parameters are reset to factory setting.</p>	



UK

9.3 Configure display (optional)

<p>▶ Select [uni] and set the unit of measurement:</p> <ul style="list-style-type: none"> - [bAr], [mbAr], - [MPa], [kPa], - [PSI], - [inHG] 		
<p> The selectable units of measurement depend on the respective unit. See table Setting ranges (→ 11.1.1).</p>		
<p>▶ Select [diS] and set the update rate and orientation of the display:</p> <ul style="list-style-type: none"> - [d1]: update of the measured values every 50 ms. - [d2]: update of the measured values every 200 ms. - [d3]: update of the measured values every 600 ms. - [rd1], [rd2], [rd3]: display as for d1, d2, d3; rotated by 180°. - [OFF] = the measured value display is deactivated in the Run mode. The LEDs remain active even if the display is deactivated. Error messages are displayed even if the display is deactivated. 		
<p></p>	<p>Even with unsteady pressure characteristics [d1] provides optimum readability; the corresponding algorithms are stored.</p>	

9.4 Set output signals

9.4.1 Set output functions

<p>▶ Select [ou1] and set the switching function:</p> <ul style="list-style-type: none"> - [Hno] = hysteresis function/normally open, - [Hnc] = hysteresis function/normally closed, - [Fno] = window function/normally open, - [Fnc] = window function/normally closed, - [OFF] = output off. <p> Parameter [OFF] is only available in operating mode 3 ([CMPT] = [3]).</p>	<p>ou 1</p>
<p>▶ Select [ou2] and set the function:</p> <ul style="list-style-type: none"> - [Hno] = hysteresis function/normally open - [Hnc] = hysteresis function/normally closed - [Fno] = window function/normally open, - [Fnc] = window function/normally closed, - [OFF] = output off. <p> Parameter [OFF] is only available in operating mode 3 ([CMPT] = [3]).</p>	<p>ou2</p>

9.4.2 Set switching limits for the hysteresis function

<p>▶ [ou1] / [ou2] must be set as [Hno] or [Hnc].</p> <p>▶ Select [SP1] / [SP2] and set the value at which the output switches.</p>	<p>SP 1 SP 2</p>
<p>▶ Select [rP1] / [rP2] and set the value at which the output is reset. rPx is always smaller than SPx. The unit only accepts values which are lower than the value for SPx.</p>	<p>r-P 1 r-P 2</p>

9.4.3 Set switching limits for the window function

<p>▶ [ou1] / [ou2] must be set as [Fno] or [Fnc].</p> <p>▶ Select [FH1] / [FH2] and set the upper limit value.</p>	<p>FH 1 FH 2</p>
<p>▶ Select [FL1] / [FL2] and set the lower limit value. FLx is always lower than FHx. The unit only accepts values which are lower than the value for FHx.</p>	<p>FL 1 FL 2</p>

9.5 User settings (optional)


9.5.1 Set delay time for the switching outputs

[dS1] / [dS2] = switching delay for OUT1 / OUT2.

[dr1] / [dr2] = reset delay for OUT1 / OUT2.

- Select [dS1], [dS2], [dr1] or [dr2] and set a value between 0 and 50 s (at 0 the delay time is not active).

```
dS 1
dr 1
dS 2
dr 2
```

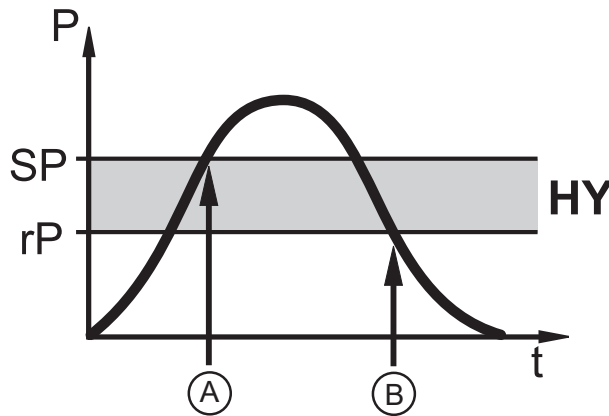

Output function:


A:

B:

[Hno] / [Hnc]

dS

dr

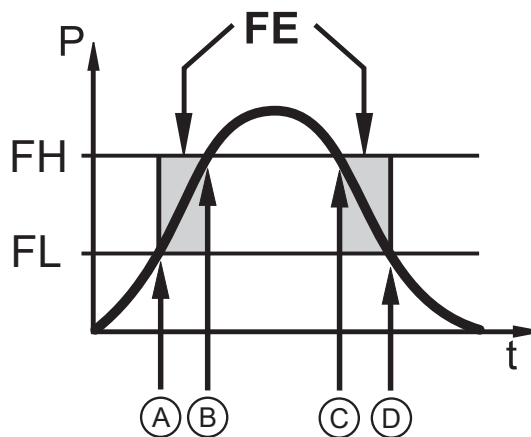

Output function:

A:

B:

C:

D:

[Fno] / [Fnc]

dS

dr

dS

dr

P = system pressure; SP = set point; rP = reset point; HY = hysteresis;
FE = window; FH = upper value; FL = lower value.



If operating mode 1 is used, the delay time will not behave as described here. Refer to the operating instructions of the old device for details: → www.ifm.com




For this unit the parameters [dSx] and [drx] for the set and reset points are designed strictly to the VDMA guideline.


9.5.2 Set output logic for the switching outputs

▶ Select [P-n] and set [PnP] or [nPn].	P--n
--	------

9.5.3 Set damping for the switching signal

▶ Select [dAP] and set the damping constant in seconds (T value: 63 %); setting range 0.000...4.000 s.	dAP
 Damping [dAP] affects the switch point / process data flow (IO-Link communication) and the display.	







9.5.4 Reset all parameters to factory setting



▶ Select [rES]. ▶ Press [•]. ▶ Press [▲] or [▼] and keep pressed until [----] is displayed. ▶ Briefly press [•]. We recommend noting down your own settings before carrying out a reset (→ 12).	rES
 The operating mode [CMPT] will also be reset to the factory setting ([CMPT] = [2]).	

9.5.5 Set colour change of the display



<p>► Select [coLr] and set the function:</p> <ul style="list-style-type: none"> - [rEd] = display colour red (independent of the measured value). - [GrEn] = display colour green (independent of the measured value). - [r1ou] = display colour red when OUT1 switches. - [G1ou] = display colour green when OUT1 switches. - [r2ou] = display colour red when OUT2 switches. - [G2ou] = display colour green when OUT2 switches. - [r-12] = display colour red when the measured value is between the limit values of OUT1 and OUT2. - [G-12] = display colour green when the measured value is between the limit values of OUT1 and OUT2. - [r-cF] = display colour red when the measured value is between the freely definable limits [cFL]^{*)} and [cFH]^{*)}. - [G-cF] = display colour green when the measured value is between the freely definable limits [cFL]^{*)} and [cFH]^{*)}. <p>^{*)} The parameters [cFL] and [cFH] can only be selected in the menu tree if [r-cF] or [G-cF] has been activated.</p>	<i>coLr</i>
<p>► Select [cFL] and set the lower limit (only possible if [r-cF] or [G-cF] has been activated).</p> <p>> The setting range corresponds to the measuring range and its maximum limit is [cFH].</p>	<i>cFL</i>
<p>► Select [cFH] and set the upper limit (only possible if [r-cF] or [G-cF] has been activated).</p> <p>> The setting range corresponds to the measuring range and its minimum limit is [cFL].</p>	<i>cFH</i>

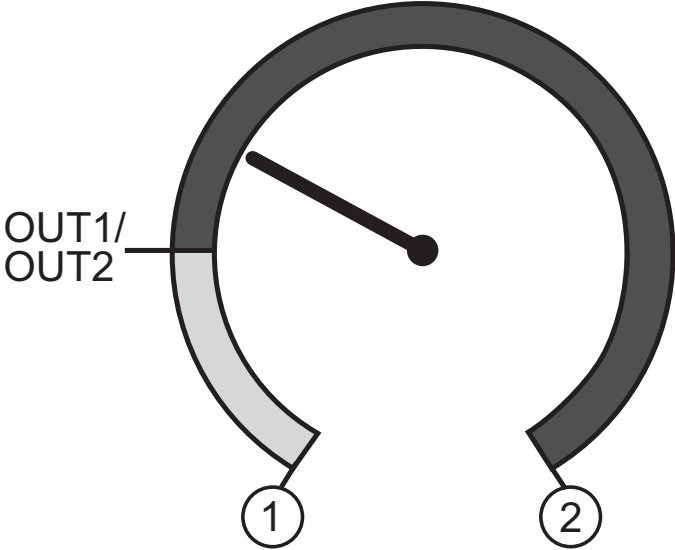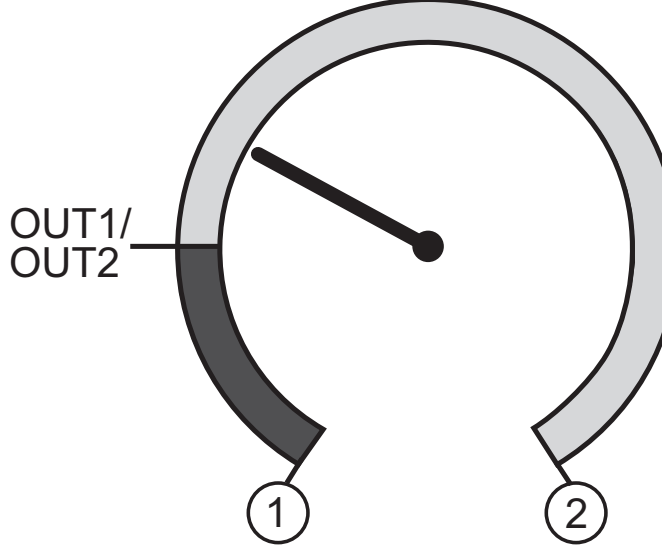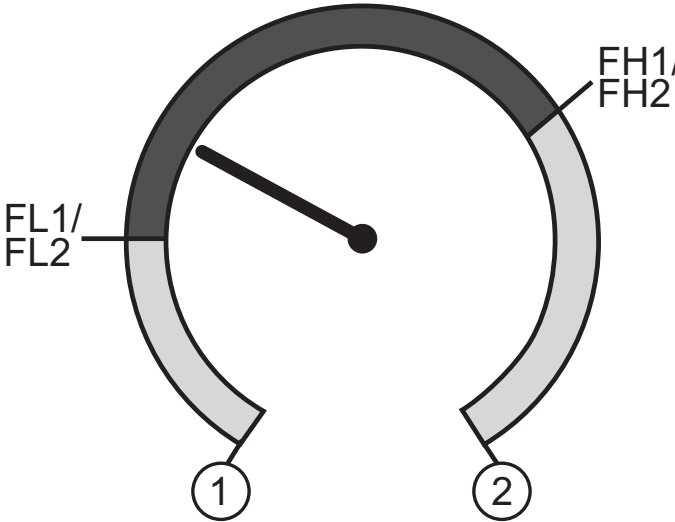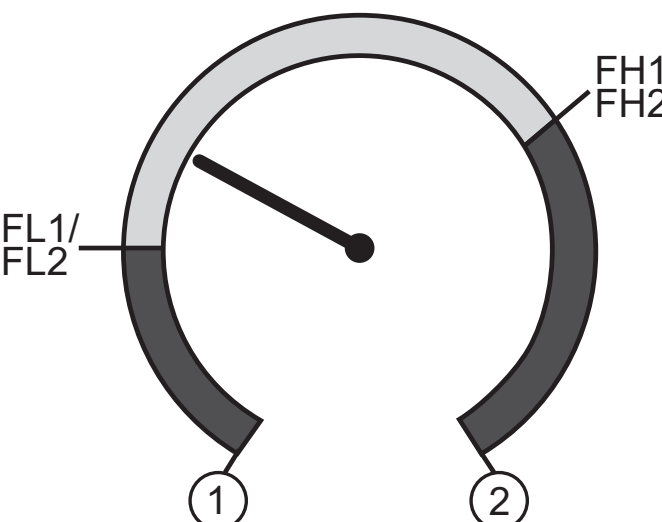

9.5.6 Graphical depiction of the colour change of the display

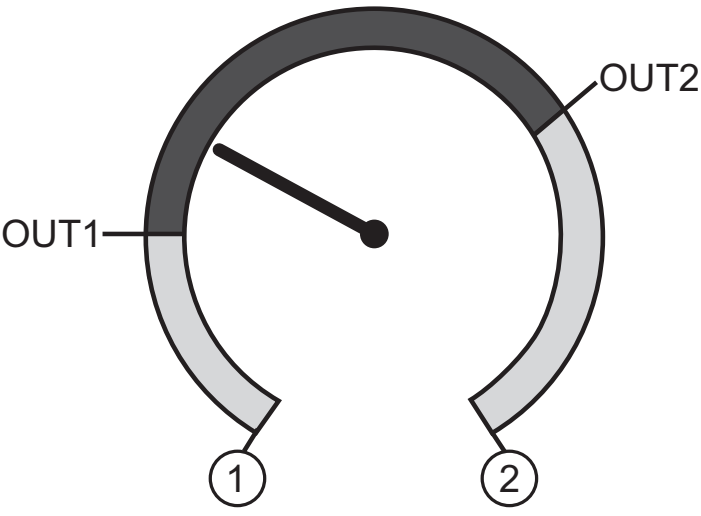
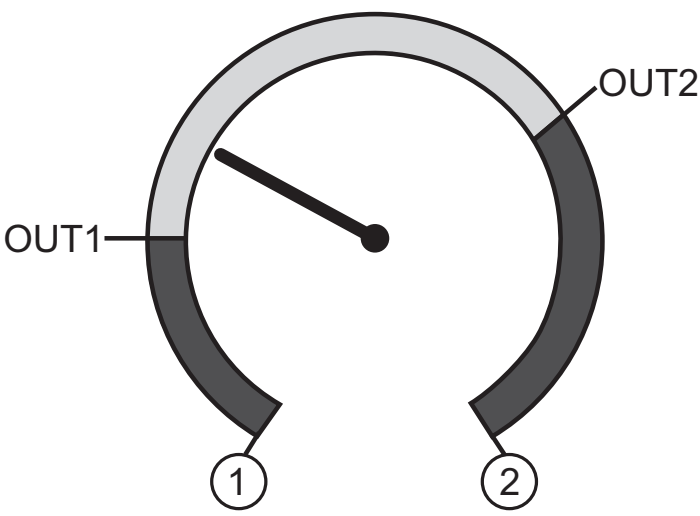
Display colour change for the parameters [r1ou] / [r2ou] , mode hysteresis function	Display colour change for the parameters [G1ou] / [G2ou] , mode hysteresis function
	
Measured value > switch point OUT1/OUT2; display = red	Measured value > switch point OUT1/OUT2; display = green
Display colour change for the parameters [r1ou] / [r2ou] , mode window function	Display colour change for the parameters [G1ou] / [G2ou] , mode window function
	
Measured value between FL1/FL2 and FH1/FH2; display = red	Measured value between FL1/FL2 and FH1/FH2; display = green
	Colour change display green
	Colour change display red
1	Initial value of the measuring range
2	Final value of the measuring range

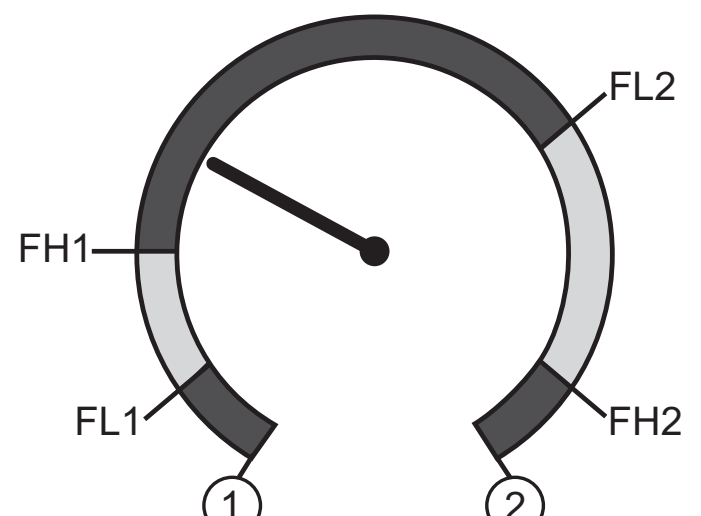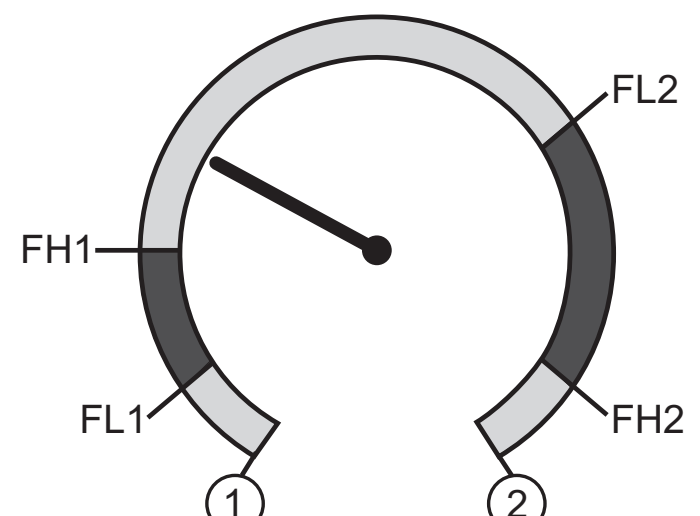

Display colour change for the parameter [r-12] , mode hysteresis function	Display colour change for the parameter [G-12] , mode hysteresis function
	
Measured value between OUT1 and OUT2; display = red	Measured value between OUT1 and OUT2; display = green

UK

Display colour change for the parameter [r-12] , mode window function	Display colour change for the parameter [G-12] , mode window function
	
Measured value outside FL1...FH1 and FL2...FH2; display = red	Measured value outside FL1...FH1 and FL2...FH2; display = green

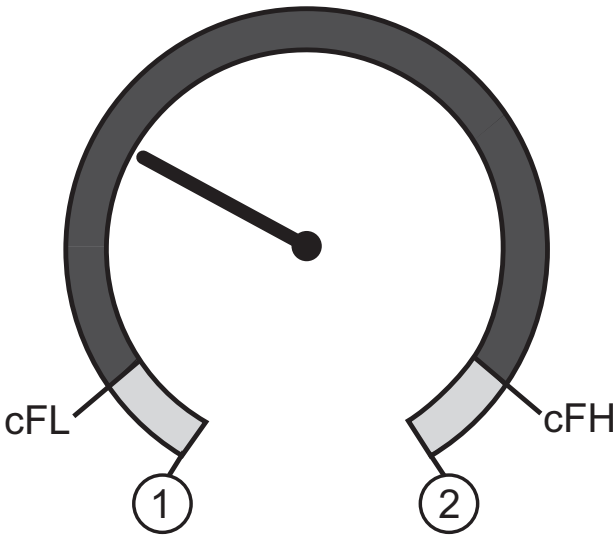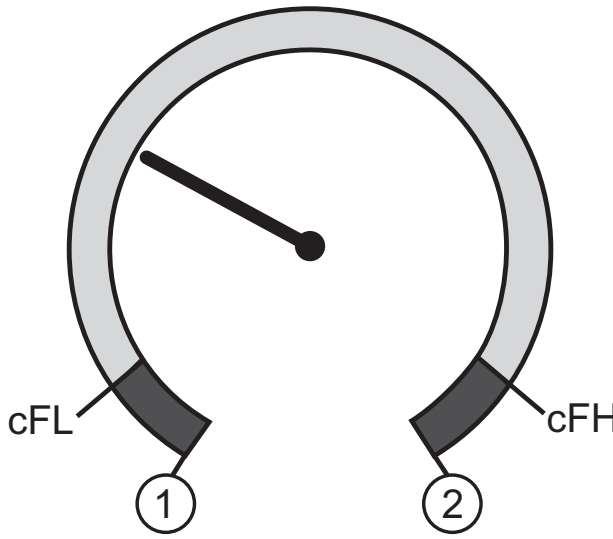	Colour change display green
	Colour change display red
1	Initial value of the measuring range
2	final value of the measuring range
FL1/FL2	Lower limit value window function outputs OUT1 / OUT2
FH1/FH2	Upper limit value window function outputs OUT1 / OUT2

Display colour change with parameter [r-cF] independent of OUT1 / OUT2.	Display colour change with parameter [G-cF] independent of OUT1 / OUT2
	
Measured value between cFL and cFH; display = red	Measured value between cFL and cFH; display = green


	Colour change display green
	Colour change display red
1	Initial value of the measuring range
2	Final value of the measuring range
cFL	Lower limit (independent of the output function)
cFH	Upper limit (independent of the output function)

9.6 Diagnostic functions

9.6.1 Read min/max values for the system pressure

<ul style="list-style-type: none">▶ Select [Hi] or [Lo] and briefly press [●]. [Hi] = maximum value, [Lo] = minimum value. Delete memory:▶ Select [Hi] or [Lo].▶ Press [▲] or [▼] and keep pressed until [----] is displayed.▶ Briefly press [●].	<i>Hi</i> <i>Lo</i>
--	----------------------------

9.6.2 Read overload processes

<ul style="list-style-type: none">• HIPC: Number of overload processes HIPC counts how often the limit HIPS has been exceeded. The limit must be exceeded for at least 0.5 ms.• HIPS: Setting of the threshold for the overload counter.	<i>HIPC</i> <i>HIPS</i>
 The parameters HIPC and HIPS are only available via IO-Link communication.	

UK

10 Operation

After power on, the unit is in the Run mode (= normal operating mode). It carries out its measurement and evaluation functions and provides output signals according to the set parameters.

Operation indication (→ 7 Operating and display elements).

10.1 Read the set parameters

- ▶ Press [●].
- ▶ Press [▲] or [▼] until the required parameter is displayed.
- ▶ Briefly press [●].
- > The unit displays the corresponding parameter value for approx. 30 s; then it changes to the process value display.

10.2 Self-diagnostics / fault indications

The unit has many self-diagnostic options.

- It monitors itself automatically during operation.
- Warnings and faults are displayed (even if the display is deactivated), in addition they are available via IO-Link.

Display	Status LED OUT1	Status LED OUT2	Type of fault *)	Fault / warning	Corrective measures
none			F	Supply voltage too low.	▶ Check / correct the supply voltage.
SC flashes	flashes	flashes	F	Excessive current on switching outputs OUT1 and OUT2 **).	▶ Check switching outputs for short-circuit or excessive current; remove the fault.
SC1 flashes	flashes		F	Excessive current on switching output OUT1 **).	▶ Check switching output OUT1 for short-circuit or excessive current; remove the fault.
SC2 flashes		flashes	F	Excessive current on switching output OUT2 **).	▶ Check switching output OUT2 for short-circuit or excessive current; remove the fault.
Loc			W	Parameter setting locked via pushbuttons.	▶ Unlock buttons (→ 9.1 Parameter setting in general) → "Locking / unlocking".
C.Loc			W	Parameter setting locked via pushbuttons, parameter setting is active via IO-Link communication (→ 9.1).	▶ Wait until parameter setting via IO-Link is finished.
S.Loc			W	Setting buttons locked via parameter software. Parameter change is rejected (→ 9.1).	▶ Unlocking only possible via IO-Link interface/parameter setting software.
OL			W	Process value too high (measuring range exceeded).	▶ Check / reduce system pressure / select unit with corresponding measuring range.

Display	Status LED OUT1	Status LED OUT2	Type of fault *)	Fault / warning	Corrective measures
UL			W	Process value too low (value below measuring range).	▶ Check / increase system pressure / select unit with corresponding measuring range.
Err flashes			F	Internal fault / malfunction.	▶ Contact the manufacturer.

UK

*) F = fault

W = warning

**) The output remains deactivated as long as the excessive current / short circuit continues.

11 Technical data

11.1 Setting ranges



The setting ranges depend on the operating mode (→ 4.1).

11.1.1 Setting ranges in operating mode 2

		rP / SP		cFL / cFH		ΔP
		Setting range	Min. distance	Setting range	Min. distance	
PN7160 PN7560	bar	2...600	2	0...600	2	2
	psi	20...8700	40	0...8700	40	20
	MPa	0.2...60	0.2	0...60	0.2	0.2
PN7070 PN7570	bar	2...400	2	0...400	2	2
	psi	20...5800	40	0...5800	40	20
	MPa	0.2...40	0.2	0...40	0.2	0.2
PN7071 PN7571	bar	1...250	2	0...250	2	1
	psi	20...3620	20	0...3620	20	20
	MPa	0.1...25	0.2	0...25	0.2	0.1

ΔP = step increment

		rP / SP		cFL / cFH		ΔP
		Setting range	Min. distance	Setting range	Min. distance	
PN7092 PN7592	bar	0.5...100	0.5	0...100	0.5	0.5
	psi	5...1450	10	0...1450	10	5
	MPa	0.05...10	0.05	0...10	0.05	0.05
PN7093 PN7593	bar	0.1...25	0.2	0...25	0.2	0.1
	psi	2...362	2	0...362	2	2
	MPa	0.01...2.5	0.02	0...2.5	0.02	0.01
PN7094 PN7594	bar	-0.95...10	0.05	-1...10	0.05	0.05
	psi	-14...145	1	-14.5...145	1	0.5
	MPa	-0.095...1	0.005	-0.1...1	0.005	0.005
PN7096 PN7596	bar	0.01...2.5	0.02	0...2.5	0.02	0.01
	psi	0.2...36.2	0.2	0...36.2	0.2	0.2
	kPa	1...250	2	0...250	2	1
PN7097 PN7597	mbar	5...1000	5	0...1000	5	5
	psi	0.05...14.5	0.1	0...14.5	0.1	0.05
	kPa	0.5...100	0.5	0...100	0.5	0.5
	inHG	0.1...29.5	0.2	0...29.5	0.2	0.1
PN7099 PN7599	mbar	-990...1000	10	-1000...1000	10	10
	psi	-14.4...14.5	0.2	-14.5...14.5	0.2	0.1
	kPa	-99...100	1	-100...100	1	1
	inHG	-29.4...29.6	0.4	-29.6...29.6	0.4	0.2

ΔP = step increment

11.1.2 Setting ranges in operating mode 3

		rP / SP		cFL / cFH		ΔP
		Setting range	Min. distance	Setting range	Min. distance	
PN7160 PN7560	bar	2...600	2	0...600	2	1
	psi	26...8702	21	0...8702	27	1
	MPa	0,2...60	0,2	0...60	0,2	0,1

ΔP = Schrittweite

		rP / SP		cFL / cFH		ΔP
		Setting range	Min. distance	Setting range	Min. distance	
PN7070 PN7570	bar	1...400	2	0...400	2	1
	psi	20...5802	30	0...5802	30	1
	MPa	0,1...40	0,2	0...40	0,2	0,1
PN7071 PN7571	bar	1...250	2	0...250	2	1
	psi	12...3626	19	0...3626	19	1
	MPa	0,1...25	0,2	0...25	0,2	0,1
PN7012 PN7512	bar	0,5...160	0,8	0...160	0,8	0,1
	psi	7...2321	12	0...2321	12	1
	MPa	0,05...16	0,08	0...16	0,08	0,01
PN7092 PN7592	bar	0,3...100	0,5	0...100	0,5	0,1
	psi	5...1450	8	0...1450	8	1
	MPa	0,03...10	0,05	0...10	0,05	0,01
PN7043 PN7543	bar	0,1...40	0,2	0...40	0,2	0,1
	psi	2...580	3	0...580	3	1
	MPa	0,012...4	0,02	0...4	0,02	0,001
PN7093 PN7593	bar	0,1...25	0,2	0...25	0,2	0,1
	psi	1...363	2	0...363	2	1
	MPa	0,01...2,5	0,02	0...2,5	0,02	0,01
PN7014 PN7514	bar	-0,95...16	0,08	-1...16	0,08	0,01
	psi	-13,8...232,1	1,2	-14,5...232,1	1,2	0,1
	MPa	-0,095...1,6	0,008	-0,1...1,6	0,008	0,001
PN7094 PN7594	bar	-0,97...10	0,05	-1...10	0,05	0,01
	psi	-14...145	0,8	-14,5...145	0,8	0,1
	MPa	-0,097...1	0,005	-0,1...1	0,005	0,001
PN7015 PN7515	bar	-0,98...6	0,03	-1...6	0,03	0,001
	psi	-14,2...87	0,5	-14,5...87	0,5	0,1
	kPa	-98...600	3	-100...600	3	1

UK

ΔP = Schrittweite

		rP / SP		cFL / cFH		ΔP
		Setting range	Min. distance	Setting range	Min. distance	
PN7096 PN7596	bar	0,01...2,5	0,02	0...2,5	0,02	0,01
	psi	0,1...36,3	0,2	0...36,3	0,2	0,1
	kPa	1...250	2	0...250	2	1
PN7097 PN7597	mbar	3...1000	5	0...1000	5	1
	psi	0,05...14,5	0,08	0...14,5	0,08	0,01
	kPa	0,3...100	0,5	0...100	0,5	0,1
	inHG	0,1...29,5	0,2	0...29,5	0,2	0,1
PN7099 PN7599	mbar	-993...1000	10	-1000...1000	10	1
	psi	-14,4...14,5	0,2	-14,5...14,5	0,2	0,1
	kPa	-99...100	1	-100...100	1	1
	inHG	-29,3...29,5	0,3	-29,5...29,5	0,3	0,1

ΔP = Schrittweite

11.2 Further technical data



Further technical data and scale drawing at: www.ifm.com.

12 Factory setting

	Factory setting	User setting
SP1	25% VMR*	
rP1	23% VMR*	
OU1	Hno	
OU2	Hno	
SP2	75% VMR*	
rP2	73% VMR*	
dS1	0.0	
dr1	0.0	
dS2	0.0	
dr2	0.0	
P-n	PnP	
dAP	0.06	
Uni	bAr / mbAr	
colr	rEd	
diS	d2	
cFH	VMR	
cFL	MAW	
HIPS**	VMR	
CMPT***	2	

- VMR final value of the measuring range, (MAW) initial value of the measuring range
- * = The indicated percentage of the final value of the measuring range (VMR) of the respective sensor (for PN7xx9 the percentage of the measuring span) is set.
- ** = HIPS is only available via IO-Link communication.
- *** = Menu item [CMPT] is not available for all articles (→ 4.1).

More information at www.ifm.com